

Superior THREAD HOLDER™


NOTE: Cones are designed to have the thread pulled over the top.


For Use With Cones (Figure A)


- 1) Extend arm into upright position
- 2) Place cone adapter on thread pin
- 3) Place cone on cone adapter
- 4) Pull thread through holes 3 and 4
- 5) Thread your machine as usual






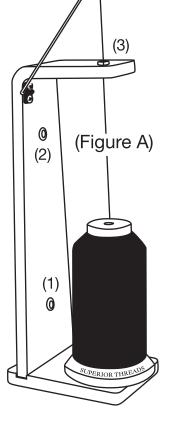

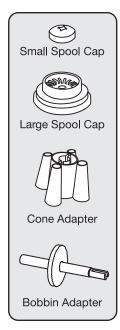

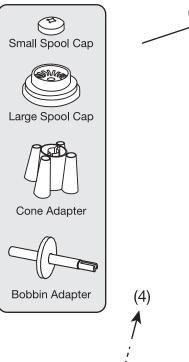

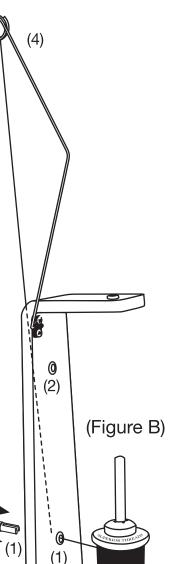

For Use With Spools (Figure B)

- 1) Extend arm into upright position
- 2) Place spool onto thread pin
- 3) Fit appropriate spool cap loosely above spool
- 4) Pull thread through holes 1 and 4 as indicated in Figure B
- 5) Thread your machine as usual

NOTE: Most spools are designed to rotate on the thread pin except when winding bobbins.





Patent Pending

NOTE: See videos on our website for additional instructions.